

1. Ready to start your project? ...

Before doing anything it's a good idea to have a clean safe work area.

2. The great thing about Voodooliner, its water-based, Eco Friendly and unlike some products on the market, Voodooliner is safe to use.
But suitable safety equipment should Always be used!



- 3. Always a good idea to place drop sheets around work area during whole process...
- 4. prep work...Sand all surfaces with 40-80 grit sandpaper using either, hand, orbital sander or wire brush, NO need to sand back to bare Metal.









Sanding all surface areas to be coated, IS "KEY" TO SUCCESSFUL ADHESION,

5. Ensure all surfaces are free of rust, grease & contamination and removed & surface is well etched before coating.

(note, its not necessary to sand surface down to bare metal.)



6. Ok we now have a good etched surface, let's clean it, Using Acetone, clean all surfaces to remove all dust, make sure you have gloves on to protect your hands.

(Note NO degreases should be used that will leave a film on the surface, Voodoo Liner will not adhere.



7. Surface is clean? Time for masking areas not to be coated, take your, time is key! Using good quality masking tape will help with clean lines when removing.

Don't forget about the drop-sheets to

protect from any overspray!





8. Is a primer needed? YES... priming is recommended on any exposed metal or treated rusted areas, even after sanding. On plastic, wood or other surfaces no, sanding/etching will do the job nicely.



When using a primer, ideally a water based primer like Voodoo liner Metal Etch Primer is recommended. If a solvent based etch primer is used, ensure surface is touch dry before over coating with Voodoo liner RX

Ideally Voodoo liner RX application should be applied within 12 hours for good inter-coat adhesion.

9. Before opening Voodoo liner 1ltr cans or 1ltr pouches, shake for at least 3 minute before opening.















YIELD to the Power of Common Sense

11. Voodoo Liner Application.,

DO NOT APPLY VOODOO LINER
OUT-DOORS IF TEMPERATURES ARE LIKELY
TO DROP BELOW 15C WITHIN TWO HOURS
AFTER APPLICATION



Don't Apply Voodooliner if Weather Conditions Aren't Suitable To Curing, ideally all coating should be undertaken in controlled temperature, environment.



12. Ok, weathers good and you have control of the situation...
before you apply Voodoo liner RX spray a test area first...! Spray a
small test area on cardboard to get good feel of the Voodoo liner spraygun

Stand back about 2feet, Set air pressure between 40-60 psi and have a test spray.

13. Ok, good to go, for tricky areas like fenders, door handles, grills so on, stand back and apply a light coat first.

Remember standing back will give you a good feel and control of your application, before moving in closer.

14. Now you're feeling good about your spray technique, apply first coat between 40-60psi evenly to all surfaces, ensuring an even side to side application motion. Don't rush.....!!





15. Ok, first coat is <u>touch-dry</u>, (Must be touch-dry between coats, remember) you're ready to apply your second coat.

Don't apply if temperatures aren't right, getting cooler or heading below 15c/60f. If your in your garage your in control, get some heat going, If your waring a T-shirt thinking about a drink, Voodooliner will do its job and cure to touch-dry.



Second coat... Apply second coat in same matter as first coat, ideally spraying joint to joint or panel to panel, avoiding stop-start-areas as much as you can. This helps to avoid possible overspray lines or uneven higher build areas for a more uniform finish.



Side to side application Spot-starting at etchs. Voodoo liner can be build-up to any thickness by applying multiple coats.



16. Once all coating is complete, remove masking tape to see your results... Ideally as soon as second or last coat has been applied (still wet) remove tape for a clean cut tape etch. If needed a sharp cutting blade will be handy. If Voodooliner is still in early stages of curing/skinning, wait until harden enough to pull tape off without dragging coating with it.





SEND US YOUR BEFORE AND IMAGES, WE'D LOVE TO SEE
THE ACTION # 100000 LINER @ 100000 LINER
JOIN



THE